

HOW NAN EIGHT FIVE EIGHT PD BOETTCHER FROM DIETZE PDD REUR ENGMSG SIX FOUR ONE EIGHT PD CRANE HOIST ENGR ADVISES HOIST OPERATION YOU DESCRIEE NOT NORMAL PD HOIST IS EQUIPPED WITH MECHANICAL LOAD BRAKE BUILT INTO QUOTE DORRIS UNQUOTE SPEED REDUCER PD THIS BRAKE EVIDENTLY IS NOT FUNCTIONING PROPERLY PD COVER MUST BE REMOVED FROM SPEED REDUCER TO CHECK OPERATION OF LOAD BRAKE AND TO ADJUST BRAKE PD IF SPEED REDUCER IS FOUND TO BE DAMAGED BEYOND REPAIR AT JOBSITE CMM SPEED REDUCER FROM ANY OTHER CRANE HOIST MACHINE AT JOBSITE CAN BE SUBSTITUTED PENDING DELIVERY OF REPLACEMENT SPEED REDUCER PD ALL CRANE HOIST SPEED REDUCERS ARE IDENTICAL AND AVAILABLE FROM LOSA STOCK PD VILL DEFER PLACING

NATIONAL ARCHIVES REPOSITORY <u>PACIFIC SOUTHWEST REGION</u> COLLECTION <u>RG 326 ATOMIC ENERGY COMMISSION</u> BOX NO. <u>199624 (#608) A16334 326-65voi7c</u> ELMER GENERAL FOLDER <u>JOB 884 PROJECT ENGINEERING</u> FILE

850

P A GE TWO UWLX 01

-

s,

ORDER FOR NEW SPEED REDUCER OR SPARE PARTS PENDING REPLY FROM YOU 28/2255Z